
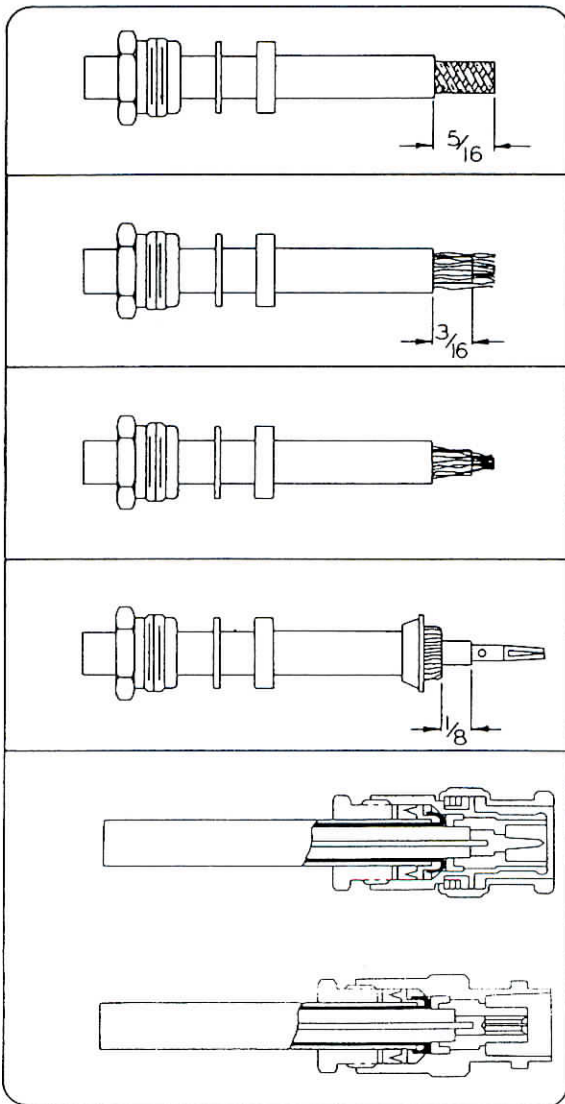


IMPROVED GASKET ASSEMBLY INSTRUCTIONS

for 4-10-119 + 4-10-137

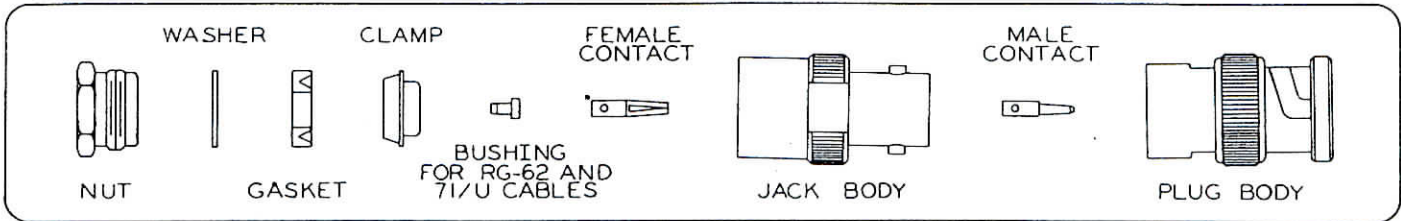

Place nut and gasket, with "V" groove toward clamp, over cable and cut jacket to dimension shown.

Comb out braid and fold out. Cut cable dielectric to dimension shown. Tin center conductor, using minimum amount of heat.

Pull braid wires forward and taper toward center conductor. Place clamp over braid and push back against cable jacket.

Fold back braid wires as shown, trim to proper length and form over clamp as shown. For RG-62 and 71 U type cable add bushing. Solder contact to center conductor, avoiding excessive heat which might swell cable dielectric.

Insert prepared cable termination into connector body. Make sure sharp edge of clamp seats properly in gasket. Tighten nut.